TELECOMMUNICATION
STANDARDIZATION SECTOR
OF ITU

G.739

GENERAL ASPECTS OF DIGITAL TRANSMISSION SYSTEMS

TERMINAL EQUIPMENTS

CHARACTERISTICS OF AN EXTERNAL ACCESS EQUIPMENT OPERATING AT 2048 kbit/s OFFERING SYNCHRONOUS DIGITAL ACCESS AT 320 kbit/s AND/OR 64 kbit/s

ITU-T Recommendation G.739

(Extract from the Blue Book)

NOTES

1	ITU-	T Reco	mmen	dation	G.73	39 w	as pu	ublis	shed	in 1	Fascic!	e III.	4 of	f the	Blue	Book.	This	file	is a	n ez	xtract	from
the Blue	Book.	While	the pre	esentat	ion a	nd la	iyou	t of	the t	ext	might	be sl	ight	tly di	iffere	nt fron	n the	Blue	Boo	ok v	ersion	n, the
contents	of the	file are	identi	cal to t	the B	lue B	Book	vers	sion a	and	copyr	ght c	ond	lition	s rem	ain un	chang	ged (see 1	belo	w).	

2	In	this	Recommendation,	the	expression	"Administration"	is	used	for	conciseness	to	indicate	both	a
telecomn	nuni	catio	n administration and	d a re	ecognized or	perating agency.								

© ITU 1988, 1993

Recommendation G.739

CHARACTERISTICS OF AN EXTERNAL ACCESS EQUIPMENT OPERATING AT 2048 kbit/s OFFERING SYNCHRONOUS DIGITAL ACCESS AT 320 kbit/s AND/OR 64 kbit/s

(Melbourne, 1988)

This Recommendation gives the characteristics of equipment (external to PCM muldexes) operating at 2048 kbit/s and providing one or several of the following tributaries into/from channel time slots of a 2048 kbit/s composite signal:

- bidirectional synchronous 64 kbit/s access (Figure 1 a/G.739);
- unidirectional synchronous 320 kbit/s access (Figure 1b/G.739).

The 320 kbit/s channel is based on the allocation of 5 x 64 kbit/s time slots, e.g. for setting up sound-programme circuits according to Recommendations J.43 and J.44. Because these circuits are specified as unidirectional, the equipment for insertion/extraction has to be separated as shown in Figure 1b/G.739.

1 General characteristics

1.1 Bit rate

The nominal bit rate is 2048 kbit/s. The tolerance on this rate is \pm 50 parts per million (ppm).

1.2 Types of external access

- a) Bidirectional synchronous insertion/extraction of 64 kbit/s data channels (see Figure 1 a/G.739).
 - *Note 1* The timing signal for the insertion side should be derived from the 2048 kbit/s incoming signal at the insertion side (I_0) ; the timing signal for the extraction side should be derived from the 2048 kbit/s incoming signal at the extraction side (E_1) .
 - *Note* 2 The provision of a timing signal output, available for the purpose of synchronizing other equipments, is an option that might be required depending upon national synchronization arrangements.
 - *Note 3* Further study is required on the possible need for an internal clock.
- b) Unidirectional synchronous insertion and extraction of a digital sound-programme signal into/out of a 320 kbit/s channel (see Figure 1 b/G.739).
 - *Note* The synchronous insertion equipment for 320 kbit/s signals requires the internal regeneration of a timing signal synchronized by the 2048 kbit/s input signal I₀. This timing signal output of the synchronous insertion equipment is used for synchronizing the sampling frequency of the analogue/digital converter.

2 Frame structure and use of derived channel time slots

2.1 Frame structure of the 2048 kbit/s signal

Refer to § 2.3 of Recommendation G.704. Bit 1 of the frame should be used in accordance with § 2.3.3 of Recommendation G.704, i.e. for a CRC check bit procedure.

2.2 Use of derived channel time slots


Time slots not accessed flow transparently through the equipment.

Note - Further study is required as to whether the binary content of time slots used at the access points should be replaced, after extraction from the composite signal, by the AIS.


2.2.1 64 kbit/s access

The number of accessible channel time slots should be at least four and the equipment shall allow access to any of channel time slots 1 to 15 and 17 to 31.

Note - Equipment exists which provides access to at least four channel time slots in the following order of priority: 6 - 22 - 14 - 30 - 2 - 18 - 10 - 26 - 4 - 20 - 12 - 28 - 8 - 24 - 5 - 21 - 13 - 29 - 1 - 17 - 9 - 25 - 3 - 19 - 11 - 27 - 7 - 23 - 15 - 31.

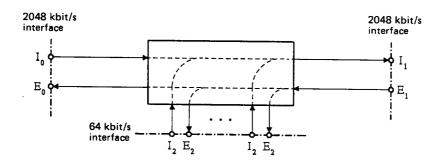

a) Bidirectional synchronous insertion/extraction of 64 kbit/s data channels

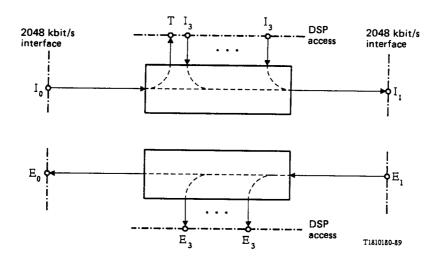

b) Unidirectional synchronous insertion and extraction of digital soundprogramme (DSP) signal into/out of a 320 kbit/s channel

 I_0 , I_1 Insertion side I_3 , E_3 Synchronous digital sound-programme signal access E_0 , E_1 Extraction side I_3 Timing signal

I₂, E₂ 64 kbit/s interface

FIGURE 1/G.739

External access equipment for 64 and 320 kbit/s channels

2.2.2 *320 kbit/s access*

The time slot allocation for digital channels with bit rate at 320 kbit/s is given in Table 1/G.739.

TABLE 1/G.739

	Digital sound- programme							
A	В	С	D	E	F	access points		
1 - 2 - 3 - 4 - 5	6 - 7 - 8 - 9 - 10	11 - 12 - 13 - 14 - 15	17 - 18 - 19 - 20 - 21	22 - 23 - 24 - 25 - 26	27 - 28 - 29 - 30 - 31	I3, T, E3 Figure 1b/G.738		

Note 1 - The six possible 320 kbit/s channels in a 2048 kbit/s stream are numbered A to F. Preferably the channel pairs A-B, C-D and E-F should be used for stereophonic transmission.

Note 2 - If the channel time slot 16 which is assigned to signalling as covered in § 5 is not needed for signalling, it may be used for purposes other than a voice channel encoded within the PCM multiplex equipment.

Frame alignment and CRC procedures both at insertion (I_0) and extraction (E_1) sides

An illustration of the procedure is given in Figure 2/G.706.

3.1 *Loss of frame alignment*

Refer to § 4.1.1 of Recommendation G.706.

3.2 Recovery of frame alignment

Refer to § 4.1.2 of Recommendation G.706.

3.3 *CRC multiframe alignment in TSO*

Refer to § 4.2 of Recommendation G.706.

3.4 *CRC bit monitoring*

Refer to § 4.3 of Recommendation G.706.

4 Fault conditions and consequent actions

4.1 Fault conditions

The equipment should detect the following conditions:

- 4.1.1 Failure of power supply.
- 4.1.2 Loss of incoming signal at I_2 or I_3 .

Note - This detection is not mandatory when contradirectional interfaces are used.

- 4.1.3 Loss of the incoming signal at 2048 kbit/s both at insertion (I_0) and extraction (E_1) sides.
- *Note 1* The detection of this fault condition is required only when it does not result in an indication of loss of frame alignment.
- *Note* 2 Where separate circuits are used for the digital signal and the timing signal, the loss of either or both should constitute loss of the incoming signal.
- 4.1.4 Loss of frame alignment both at insertion (I_0) and extraction (E_1) sides.
- 4.1.5 Excessive bit error ratio detected by monitoring the frame alignment signal at both the insertion (I_0) and extraction (E_1) sides.
- $\it Note$ The detection of this fault condition at insertion side ($\rm I_0$) depends on the type of application of this equipment in a network and therefore is not mandatory.
- 4.1.5.1 With a random bit error ratio of $\leq 10^{-4}$, the probability of activating the indication of fault condition within a few seconds should be less than 10^{-6} .

With a random bit error ratio of $\geq 10^{-3}$, the probability of activating the indication of fault condition within a few seconds should be higher than 0.95.

4.1.5.2 With a random bit error ratio of $\geq 10^{-3}$, the probability of deactivating the indication of fault condition within a few seconds should be almost 0.

With a random bit error ratio of $\leq 10^{-4}$, the probability of deactivating the indication of fault condition within a few seconds should be higher than 0.95.

Note - The activating and deactivating period specified as "a few seconds" is intended to be in the order of 4 to 5 seconds.

4.2 *Consequent actions*

Further to the detection of fault condition, appropriate actions should be taken as specified in Table 2/G.739. The consequent actions are as follows:

- 4.2.1 Prompt maintenance alarm indication generated to signify that performance is below acceptable standards and maintenance attention is required locally. When the AIS at the 2048 kbit/s inputs (I_0, E_1) is detected (see General Notes below to § 4.2), the prompt maintenance alarm indication associated with loss of frame alignment (see § 4.1.4) and excessive error rate (see § 4.1.5) should be inhibited, while the rest of the consequent actions are in accordance with those associated in Table 2/G.739 with the two fault conditions.
- *Note* The location and provision of any visual and/or audible alarm activated by the alarm indications given in § 4.2.1 is left to the discretion of each Administration.
- 4.2.2 AIS applied to E_2 , E_3 outputs (see General Notes below to § 4.2). This action should be taken as soon as possible and not later than 2 ms after the detection of the fault condition.
- 4.2.3 AIS applied to relevant time slots in the composite 2048 kbit/s output signal at insertion side (I_1) if supervision of the incoming I_2 and I_3 signal is provided.
- 4.2.4 Inhibition of I₂ or I₃ digital information insertion.
- 4.2.5 Both 2048 kbit/s signals are bypassed.

Note - The provision of this consequent action depends on the type of application of this equipment in a network and therefore is not mandatory.

4.2.6 AIS applied to the 2048 kbit/s output, extraction side (E_0) .

Note - The provision of this consequent action depends on the type of application of this equipment in a network and therefore is not mandatory.

4.2.7 AIS applied to the 2048 kbit/s output, insertion side (I_1) .

Note - The provision of this consequent action depends on the type of this equipment in a network and therefore is not mandatory.

General Notes to § 4.2

Note 1 - The equivalent binary content of the alarm indication signal (AIS) is a continuous stream of binary 1s. The strategy for detecting the presence of the AIS should be such that with a high probability the AIS is detectable even in the presence of random errors having a mean error ratio 1×10^{-3} . Nevertheless, a signal in which all the binary elements, with the exception of the frame alignment signal, are in the state 1, should not be taken as an AIS.

Note 2 - All timing requirements quoted apply equally to restoration, subsequent to the fault condition clearing.

5 Interfaces

The digital interfaces at 2048 kbit/s should be in accordance with Recommendation G.703.

The digital interfaces at 64 kbit/s should be either of the codirectional or the contradirectional type specified in Recommendation G.703.

The need to define a digital interface operating at 320 kbit/s is under study.

Note 1 - It should be noted that according to the principle of minimizing the number of different types of interfaces, the information rate of 320 kbit/s will be offered to customers at the user/network interface level using the 2048 kbit/s interface as defined in Recommendations I.431 and G.703.

Note 2 - In the case of the 64 kbit/s codirectional interface, the design of the input ports should take into account the need to provide octet alignment, to allow controlled slips when the tributary timing and that of the multiplexer timing source are plesiochronous, and to absorb jitter and wander up to the limits given in Recommendation G.823.

 $TABLE\ 2/G.739$ Fault conditions and consequent actions for the external access equipment

-		T						
			Consequent a	actions (see § 4.2)				
Fault conditions (see	§ 4.1)	Prompt maintenance alarms indication generated	AIS applied to E_2 or E_3 outputs	Inhibition of digital information insertion I ₂ , I ₃	AIS applied to the relevant time slot of the 2048 kbit/s composite signal at insertion side (I_0)	Both 2048 kbit/s signals are bypassed (see Note under § 4.2.5)	AIS applied to the 2048 kbit/s output, extraction side (E ₀) (see Note under § 4.2.6)	AIS applied to the 2048 kbit/s output, insertion side (I ₁) (see Note under § 4.2.7)
Failure of power sup	ply	Yes				Yes	Yes (if practicable)	Yes (if practicable)
Loss of incoming signal at I ₂ or I ₃ inputs (see Note under § 4.1.2)		Yes			Yes			
Loss of incoming	Extr.s. (E ₁)	Yes	Yes				Yes	
signal at 2048 kbit/s	Ins.s. (I ₀)	Yes		Yes				Yes
Loss of frame alignment (see	Extr.s. (E ₁)	Yes (see § 4.2.1)	Yes				Yes	
Note 2 of Rec. G.706, § 4.2)	Ins.s. (I ₀)	Yes (see § 4.2.1)		Yes				Yes
Error ratio 1 · 10 ⁻³ on the frame	Extr.s. (E ₁)	Yes (see § 4.2.1)	Yes				Yes	
alignment signal (see Note under § 4.1.5)	Ins.s. (I ₀)	Yes (see § 4.2.1)		Yes				Yes

Note - A Yes in the table signifies that an action should be taken as a consequence of the relevant fault condition. An open space in the table signifies that the relevant action should not be taken as a consequence of the relevant fault condition, if this condition is the only one present. If more than one fault condition is simultaneously present, the relevant action should be taken if, for at least one of the conditions, a Yes is defined in relation to this action.

6 Jitter

6.1 Jitter at 2048 kbit/s output


When there is no jitter on the 2048 kbit/s inputs (I_0, E_1) the peak-to-peak jitter at the 2048 kbit/s outputs (I_1, E_0) should not exceed 0.10 UI when it is measured within the frequency range from $f_1 = 20$ Hz to $f_4 = 100$ kHz. The equivalent binary content of the test signal applied at the 2048 kbit/s input shall be a pseudo-random bit sequence of length 2^{15} - 1 as specified in Recommendation O.151. See Figure 2/G.823.

Note - It may be necessary to include a frame alignment signal in the test signal to enable the measurement to be carried out.

- 6.2 *Jitter at* E_2 *and* E_3 *outputs*
- 6.2.1 The jitter at the E_2 (64 kbit/s) output when there is no jitter at the 2048 kbit/s input (E_1) should not exceed 0.025 UI when measured within the frequency range from $f_1 = 20$ Hz to $f_4 = 100$ kHz. The equivalent binary content of the test signal applied at the 2048 kbit/s input shall be a pseudo-random bit sequence of length 2^{15} 1 as specified in Recommendation 0.151.
- *Note* In order to carry out this measurement without invoking AIS at the 64 kbit/s output, it will normally be necessary to include a frame alignment signal in the test signal.
- 6.2.2 Since the physical and electrical characteristics of a 320 kbit/s interface are identical to those of the 2048 kbit/s interface, the jitter at the E_3 (synchronous 320 kbit/s) output when there is no jitter at the 2048 kbit/s input (E_l) is according to § 6.1 above.
- 6.3 *Jitter transfer functions*
- 6.3.1 The jitter transfer function between the 2048 kbit/s input (I_0, E_1) and the output (I_1, E_0) should not exceed the gain/frequency limits given in Figure 2/G.739.

Some Administrations require that equipment be fitted with jitter reducers. In this case, the jitter transfer function should not exceed the gain/frequency limits given in Figure 3/G.739.

- *Note 1* The 2048 kHz signal shall be modulated with sinusoidal jitter. The equivalent binary content of the test signal shall be 1000.
- Note 2 It may be necessary to include a frame alignment signal in the test signal to enable the measurement to be carried out.
- 6.3.2 The jitter transfer function between the 2048 kbit/s input (E_1) and the E_2 (64 kbit/s) output should not exceed -29.6 dB when measured over the frequency range f_0 to 10 kHz. The frequency f_0 should be less than 20 Hz and as low as possible (e.g. 10 Hz), taking into account the limitations of measuring equipment.
- *Note 1* The 2048 kbit/s test signal shall be modulated by sinusoidal jitter. The equivalent binary content of the test signal shall be 1000.
- *Note* 2 In order to carry out this measurement without invoking AIS at the 64 kbit/s output, it will normally be necessary to include a frame alignment signal in the test signal.
 - *Note 3* The jitter reduction of 1/32 due to demultiplexing is equivalent to -30.1 dB.
- 6.3.3 Since the physical and electrical characteristics of a 320 kbit/s interface are identical to those of the 2048 kbit/s interface, the jitter transfer function between the 2048 kbit/s input (E₁) and E₃ (synchronous 320 kbit/s) output is according to § 6.3.1 above.

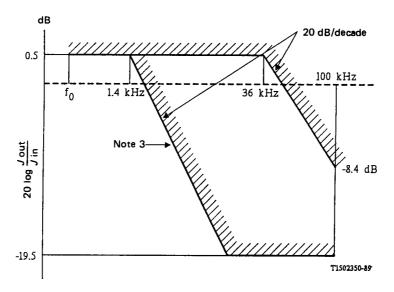


Note \it{I} - The frequency \it{f}_0 should be less than 20 Hz and as low as possible (e.g. 10 Hz), taking into account the limitations of measuring equipment.

Note 2 - To achieve accurate measurements, the use of a selective method is recommended with a bandwidth sufficiently small referred to the relevant measurement frequency, but not wider than $40~\mathrm{Hz}$.

Note 3 - For interfaces within national boundaries, this characteristic may be used.

FIGURE 2/G.739

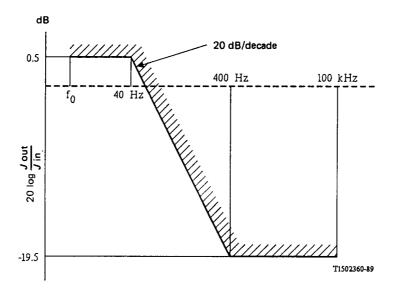

Note \it{I} - The frequency \it{f}_0 should be less than 20 Hz and as low as possible (e.g. 10 Hz), taking into account the limitations of measuring equipment.

 $\it Note~2$ - To achieve accurate measurements, the use of a selective method is recommended with a bandwidth sufficiently small referred to the relevant measurement frequency, but not wider than 40 Hz.

FIGURE 3/G.739